
Industrial connectors Han®

Info


Contents	Page
Summary Han [®] -sizes	Info 00.2
How to order connectors	Info 00.4
Hoods/Housings connector insert protection	Info 00.5
Types of hood/housing	Info 00.6
Locking systems	Info 00.8
Connection technology	Info 00.9
Electrical engineering data	Info 00.18
Current carrying capacity	Info 00.21
Metric cable thread	Info 00.23
Declaration of Conformity	Info 00.24

Summary Han®-sizes

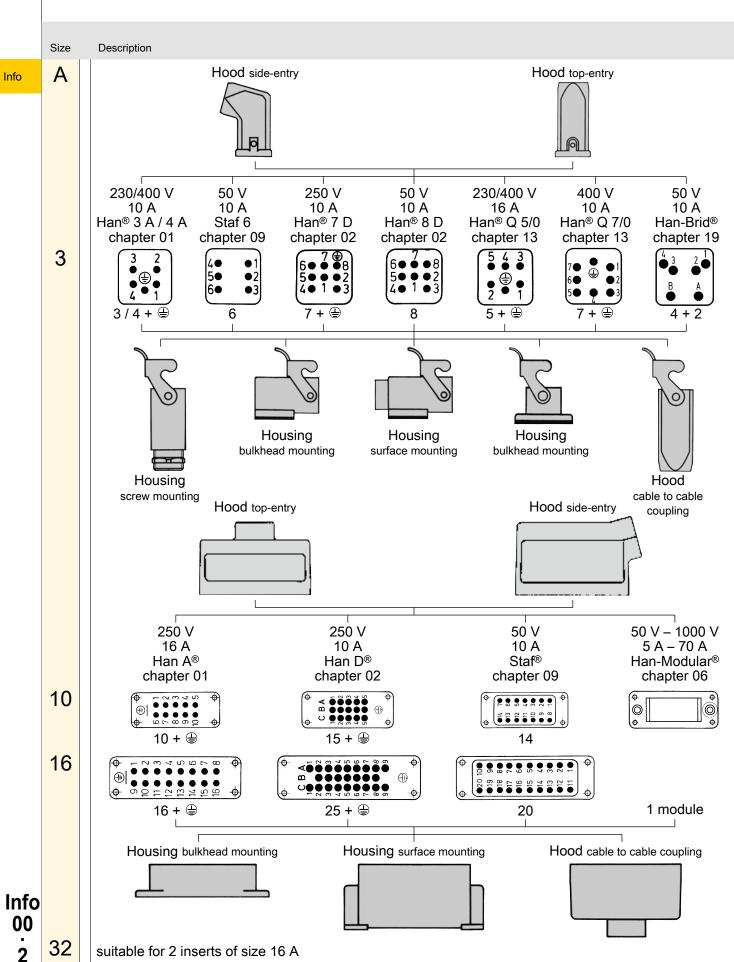


Summary Han®-sizes


Info

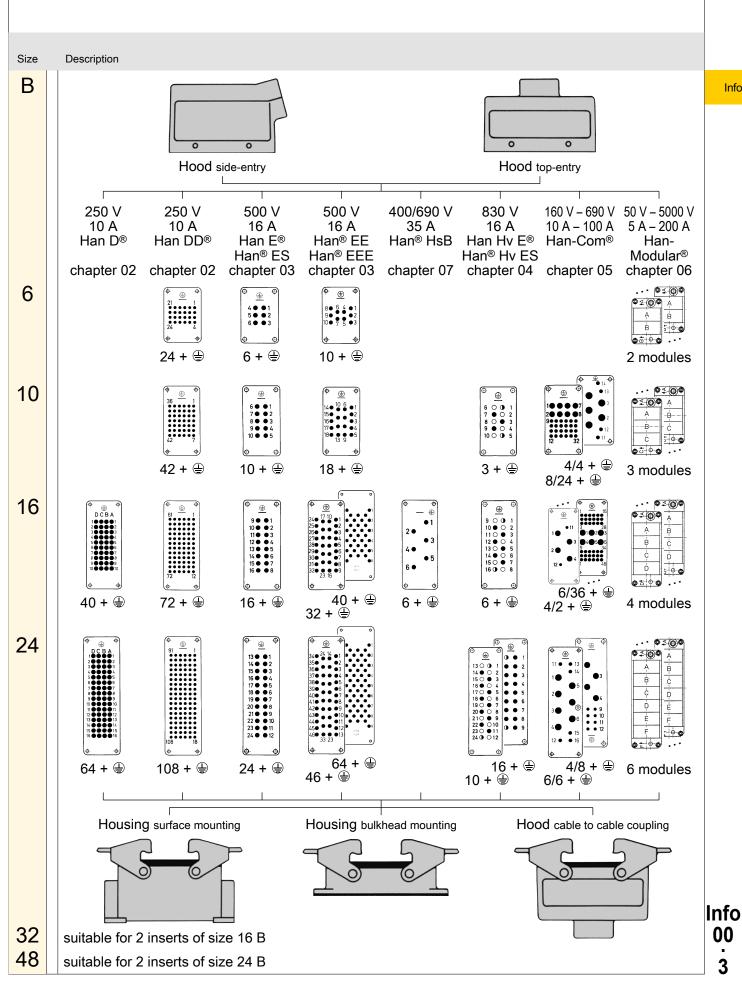

3

How to order connectors

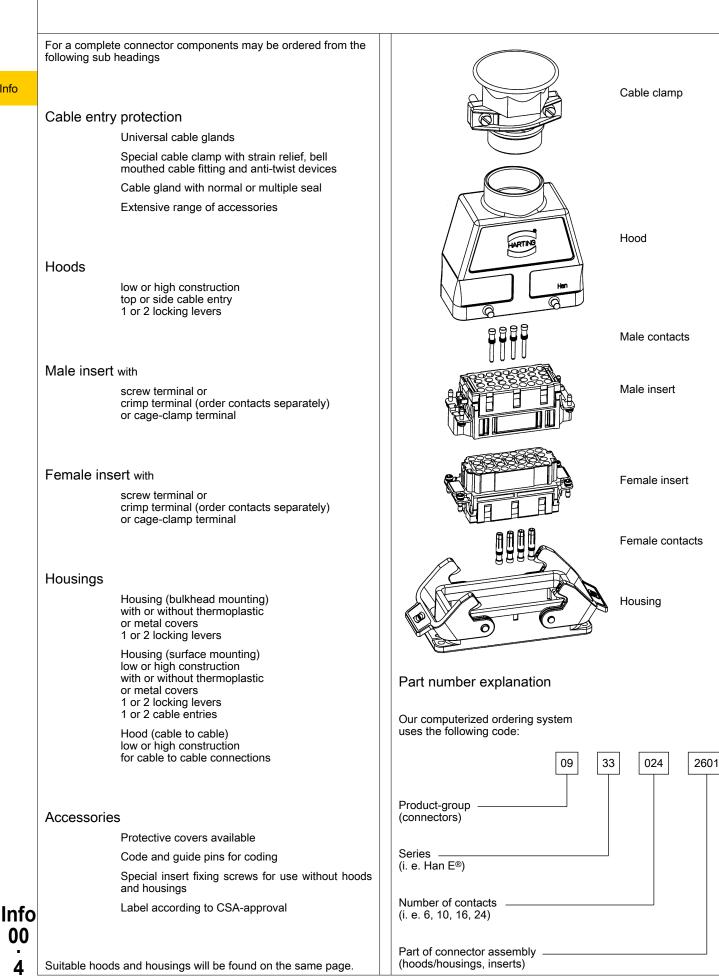

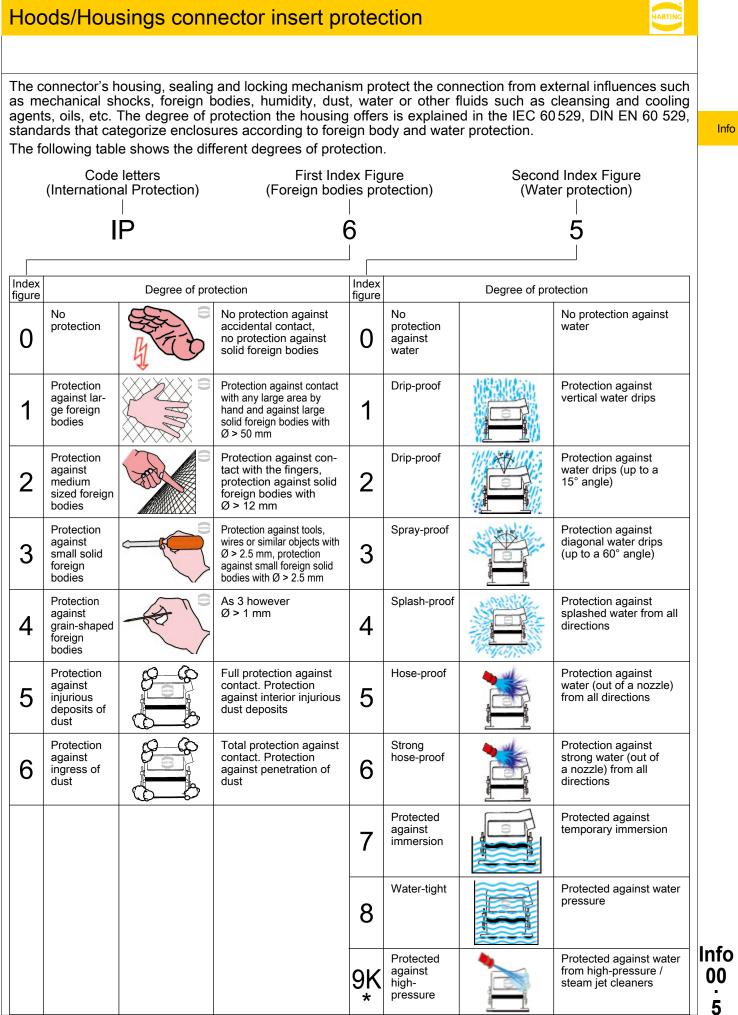

Types of hood/housing

Standard hoods/ho	usings for industrial connectors	
Field of application	For excellent mechanical and electrical protection in de- manding environments, for example, in the automobile and mechanical engineering industries also for process and regu- lation control applications	Fini
Distinguishing feature	Hoods/housings colour-coded grey (RAL 7037)	1 1
Material of hoods/housings	Die-cast light alloy	e to
Locking levers	Han-Easy Lock [®]	
Cable entry protection	Optional special cable clamp for hoods with strain relief, bell mouthed cable fitting and anti-twist devices	1. 1. 1.
Han [®] M hoods/hous	ings for more demanding environmental requirements	
Field of application	For all applications where aggressive environmental condi- tions and extreme climatic atmospheres are encountered	E.
Distinguishing feature	Hoods/housings colour-coded black (RAL 9005)	and
Material of hoods/housings	Die-cast light alloy, corrosion resistant	
Locking levers	Corrosion resistant stainless steel	
Cable entry protection	Special cable clamp for hoods with strain relief, bell mouthed cable fitting and anti-twist devices	
Han [®] EMC hoods/h	ousings for higher EMC requirements	
Field of application	For sensitive interconnections that have to be shielded against electrical, magnetic or electro-magnetic interferences	0
Distinguishing feature	Electrically conductive surface, internal seal	
Material of hoods/housings	Die-cast light alloy	
Locking levers	Han-Easy Lock®	
Cable entry protection	EMC cable clamp in order to connect the cable shielding to the hood without interruption of the shielding	5-6
Han [®] HPR hoods/h	ousings for harsh outdoor environments	
Field of application	For external electrical interconnections in vehicles, in highly demanding environments and wet areas, as well as for sensitive interconnections that have to be shielded	
Distinguishing feature	Hoods/housings colour-coded black, internal seal (RAL 9005)	
Locking parts	Stainless steel	
	Die-cast light alloy, corrosion resistant	
Cable entry protection	Optional universal cable clamp for hoods with strain relief, or special cable clamp with bell mouthed cable fitting and anti-twist devices (use of adapter is necessary)	
Han-INOX [®] hoods/I Field of application	nousings for harsh environments For excellent mechanical and electrical protection in deman- ding environments, for example, in the food, automobile and	
	mechanical engineering industries also for process and regu- lation control applications	The second
Distinguishing feature	Matt-finished metal surface	
Material of hoods/housings		
Locking levers	Stainless steel	N
Cable entry protection	Standard cable gland (stainless steel)	

Types of hood/housing

Info

Han-Eco® – Lightwe	eight hood/housing made of high-performance plastic	
Field of application	Industrial environments, outdoor applications	- all
Distinguishing feature	Black plastic hoods / housings	
Material of hoods/housings	Polyamide (glass-fibre reinforced)	(a)
Locking levers	Double locking lever / single locking lever (10 A / 16 A) (polyamide, glass-fibre reinforced)	Leis
Cable entry protection	Integrated plastic cable gland (optional) for sizes 6 B, 10 B, 16 B, 24 B / 10 A, 16 A	
Han-Yellock [®] – Cor	npact hood/housing in a shapely design	
Field of application	Industrial environments (e.g. in robotics, machinery)	
Distinguishing feature	Internal locking mechanism, push-buttons, two-part hood	
Material of hoods/housings	Zinc die-cast, aluminum	
Locking parts	Stainless steel and polyamide	
	Standard cable gland (with metric threads	

Recommended tightening torque for housings, bulkhead mounting

Series	Number of screws	Size of screws	Recommended Tightening torque (Nm)	Remarks
Han [®] 3 A	2	M 3	0.8 1.0	Gasket
Han [®] 10 A / 16 A	4	M 3	0.8 1.0	Gasket
Han [®] 10 EMV / 16 EMV	4	M 3	min. 1.0	O-ring
Han [®] 32 A	4	M 4	0.8 1.0	Gasket
Han [®] 6 B / 10 B / 16 B / 24 B	4	M 4	0.8 1.0	Gasket
Han [®] 32 B	4	M 5	min. 2.5	O-ring
Han [®] 48 B	4	M 6	min. 3.0	O-ring
Han [®] 3 HPR	2	M 4	min. 1.0	O-ring
Han [®] 6 / 10 / 16 / 24 HPR	4	M 6	min. 3.0	O-ring
Han [®] 48 HPR	4	M 8	min. 5.0	O-ring

To offer safe protection the surface condition for mounting panel should be according to DIN 4766:

• Waviness ≤ 0.2 mm on 200 mm distance


Roughness R_a

≤ 16 µm


General remark for assembling

During assembly and handling of the connector, any kind of damage to the surface of the housing must be avoided to guarantee the correct surface protection.


Locking systems

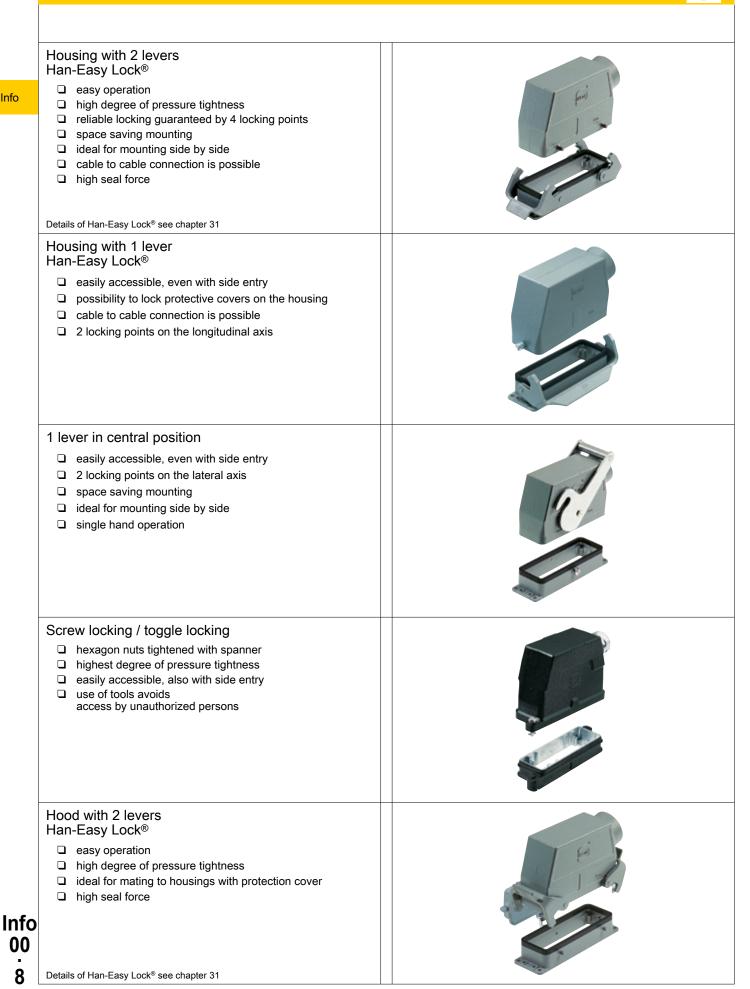

Crimp connection

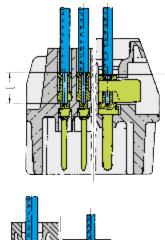

Han DD[®] Han D[®] R 15 Han-Modular[®] (10 A) Han E[®] Han A[®] Han Hv E[®]

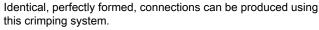

Crimp-cross section



HARTING-crimp profile



BUCHANAN crimp profile

Tensile strength of crimped connections (Table 1 of the DIN EN 60 352-2)

Conductor cros	ss-section	Tensile strength
mm²	AWG	N
0.05	30	6
0.08	28	11
0.12	26	15
0.14		18
0.22	24	28
0.25		32
0.32	22	40
0.5	20	60
0.75		85
0.82	18	90
1.0		108
1.3	16	135
1.5		150
2.1	14	200
2.5		230
3.3	12	275
4.0		310
5.3	10	355
6.0		360
8.4	8	370
10.0		380

Wire g	auge	Internal diameter	Strippir	Stripping length I (mm)					
(mm²)	(mm²) AWG		Han [®] DD Han [®] D R15 Han-Modular [®] (10 A)	Han E [®] Han A [®] Han Hv E [®]	Han® C				
0.14 0.37	26 22	0.9	8	-	-				
0.5	20	1.15	8	7.5	-				
0.75	18	1.3	8	7.5	-				
1	18	1.45	8	7.5	-				
1.5	16	1.75	8	7.5	9.5				
2.5	14	2.25	6	7.5	9.5				
4	12	2.85	-	7.5	9.5				
6	10	3.5	-	-	9.5				
10	8	4.3	-	-	12-18				

Han-Com $^{(e)}$ (40 A) Han-Modular $^{(e)}$ (40 A) Han $E^{(e)}$ Han $A^{(e)}$ Han Hv $E^{(e)}$ Han $^{(e)}$ EE Han $^{(e)}$ EEE Han-Modular $^{(e)}$ (16 A) Han $^{(e)}$ Q

A perfect crimp connection is gastight, therefore corrosion free and amounts to a cold weld of the parts being connected. For this reason, major features in achieving high quality crimp connections are the design of the contact crimping parts and of course the crimping tool itself. Wires to be connected must be carefully matched with the correct size of crimp contacts. If these basic requirements are met, users will be assured of highly reliable connections with low contact resistance and high resistance to corrosive attack.

The economic and technical advantages are:

- Constant contact resistance as a result of precisely repeated crimp connection quality
- Corrosion free connections as a result of cold weld action
- Pre-preparation of cable forms with crimp contacts fitted
- Optimum cost cable connection

Requirements for crimp connectors are laid down in DIN EN 60352-2 as illustrated in the table.

Pull out force of stranded wire

The main criterion by which to judge the quality of a crimp connection is the retention force achieved by the wire conductor in the terminal section of the contact. DIN EN 60 352-2 defines the extraction force in relation to the cross-section of the conductor. When fitted using HARTING crimping tools and subject to their utilization in an approved manner, our crimp connectors comply with the required extraction forces.

Crimping tools


Crimping tools (hand operated or automatic) are carefully designed to produce with high pressure forming parts a symmetrical connection of the crimping part of the contact and the wire being connected with the minimum increase in size at the connection point. The positioner automatically locates the crimp and wire at the correct point in the tool.

A ratchet in the tool performs 2 functions:

- It prevents insertion of the crimp into the tool for crimping before the jaws are fully open
- It prevents the tool being opened before the crimping action is completed



Screw terminal

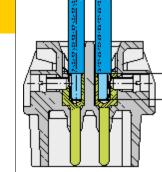

Screw terminals meet VDE 0609 /EN 60 999. Dimensions and tightening torques for testing are shown in following table. Screw dimensions and tightening torque for screw terminals

Wire gauge (mm ²)	1.5	2.5	4	6	10	16
Screw thread	М3	М3	M3.5	M4	M4	M6
Test moment of torque (Nm)	0.5	0.5	0.8	1.2	1.2	1.2*
min. pull-out for stranded wire (N)	40	50	60	80	90	100

* for screws without heads

The relevant regulations state that in the case of

• Terminals with wire protection



the use of ferrules is not necessary. Series Han $E^{\circledast},$ Han^{ $\!\!\!\rm B}$ HsB, Han Hv $E^{\otimes},$ Han^{ $\!\!\!\rm S}$ K 6/12, Han^{ $\!\!\!\!\rm S}$ K 6/6

• Terminals without wire protection



The insulation is first stripped and then a wire ferrule must be used. Series Han® K 4/x, Han A®, Staf®

Screw terminal

Inserts	Wire pr	Wire protection		min. wire gauge		max. wire gauge*	
insens	Yes	No	mm²	AWG	mm²	AWG	mm
Han [®] 3 A, Han [®] 4 A		х	0.75	18	1.5	16	4.5
Han [®] 10 A, 16 A, 32 A		х	0.75	18	2.5	14	7.5
Han E [®] , Hv E [®]	Х		0.75	18	2.5	14	7.5
Han [®] HsB	Х		1.5	16	6	10	11.5
Han [®] K 6/6, K 6/12 (signal contacts)	x		0.2	24	2.5	14	7.5
Han [®] K 4/2, K 4/8 (signal contacts)		х	0.5	20	2.5	14	7.5
Han [®] K 4/0, K 4/2, K 4/8 (power contacts)		х	1.5	16	16	6	14
Han E [®] AV, Han D [®] AV	Х		0.2	24	2.5	14	8 11
Staf®		Х	0.5	18	1.5	16	4.5

* Rated wire gauge according to DIN EN 60 999-1

Info


Recommended screw drivers and tightening torques


Screw size	Connector type	Tightening torque (Nm)	Tightening torque (lbft)	Recommended screw driver
M2.5	Cover / cable clamp screws: Han [®] Megabit, Han [®] Gigabit, Han [®] Shielded Module	0.40	0.30	PH 1
M3	Screw terminals: Han [®] 3 A, Han [®] 4 A, Han [®] Q 5/0 (PE), Han [®] Q 7/0 (PE), Staf [®]	0.25	0.20	slotted 0.4 x 2.5
M3	Screw terminals: Han D [®] AV, Han E [®] AV, Han [®] K 6/6, Han [®] K 6/12 (signal)	0.50	0.40	slotted 0.5 x 3.0
M3	Screw terminals: Han [®] 10A 32A, Han [®] E, Han Hv E [®] , Han [®] HsB	0.50	0.40	slotted 0.6 x 3.5 or PH 1
M3	Screw terminals: Han [®] E High Temp, Han [®] Thermocouple	0.50	0.40	slotted 0.6 x 3.5
M3	Cable clamp screws: Han-Quintax [®] , Han-Quintax [®] High Density, Han [®] D Coax, Han [®] E Coax	0.70	0.50	slotted 0.6 x 3.5
M3	Cable clamp screws: Han [®] D-Sub, USB Module	0.50	0.40	slotted 0.6 x 3.5 or PH 1
M3	Fixing screws: Connectors sizes 10 A, 16 A	0.50 0.40		slotted 0.6 x 3.5 or PH 1
M3	Fixing screws: Connectors sizes 6 B 24 B	0.50	0.40	slotted 0.6 x 3.5 or PH 2
M3	Ground terminals: Han-Modular [®] Hinged frames 1 2.5 mm ²	0.80 0.60		slotted 0.6 x 3.5 or PH 2
M3	Han [®] guiding pins and bushes	0.50 0.40		slotted 1 x 6.0
M3.5	Ground terminals: Han [®] 10 A, Han [®] 16 A, Han 15 D [®] , Han 25 D [®]	0.80	0.60	slotted 0.6 x 3.5 or PH 1
M4	Screw terminals: Han [®] HsB	1.20	0.90	slotted 0.6 x 3.5 or PH 1
M4	Fixing screws: Han-Yellock®	1.20	0.90	slotted 0.8 x 4.5 or PH 2
M4	Ground terminals: Han-Modular [®] Hinged frames 4 10 mm ²	1.20	0.90	slotted 0.6 x 3.5 or PH 2
M4	I4 Ground terminals: Han E [®] , Han [®] ES, Han [®] ESS, Han [®] ES Press, Han Hv E [®] , Han [®] Hv ES, Han E [®] High Temp, Han 40 D [®] , Han 64 D [®] , Han DD [®] , Han [®] K 8/24, Han [®] K 4/X, Han [®] K 6/12, Han [®] K 6/36		0.90	slotted 0.8 x 4.5 or PH 2
M5	Ground terminals: Han [®] HsB, Han [®] K12/2, Han [®] K4/X, Han [®] K6/12, Han [®] K6/36	2.00	1.40	slotted 0.8 x 4.5 or PH 2
M6	Screw terminals: Han [®] K power contacts, Han-Eco [®] PE module	for Han [®] K se Han-Eco [®] PE mo		slotted 0.8 x 4.5


Increasing the tightening torque does not improve considerably the contact resistances. The torque moments were determined when optimum mechanical, thermal and electrical circumstances were given. If the recommended figures are considerably exceeded the wire or the termination can be damaged.

Info

Han-Quick Lock® termination technique

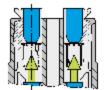

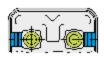

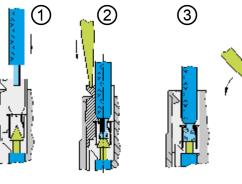

4

This new termination technique from HARTING combines the reliability and the simple operation of the cage clamp termination with the low space requirements of crimp technology.

Han-Quick Lock[®] is ideally suited to high contact densities and is considerably superior over other termination techniques. No other technology is so simple, space saving and fast. For this vibration safe termination, no special tools are necessary.

- Fast, simple and robust termination technique
- Field assembly without a special tool
- Compatible also to inserts with other termination technologies
- Combines high contact density similar to crimp termination with the simple connection like a cage clamp terminal
- For stranded wire according to IEC 60228 Class 5

Insert connectors:

Han[®] 3 A Han[®] 4 A Han[®] 7 D Han[®] 8 D Han[®] Q 4/2 Han[®] Q 5/0 Han[®] Q 5/0 Han[®] Q 8/0 Han[®] Q 12/0 Han[®] EE modules Han[®] DD modules Han[®] PushPull Power 4/0

Technical characteristics:

Material Isolation body Active termination element Quick-Lock spring Contact

Blue slide

Black slide

Stripping length Insulating resistance Flammability Termination tool Polycarbonate Stainless steel Copper alloy


Polycarbonate

Terminal cross-section 0.5 ... 2.5 mm² / AWG 20 ... 14

Terminal cross-section 0.25 ... 1.5 mm² / AWG 23 ... 16

10 mm > 10¹⁰ Ohm according to UL 94 V 0 Screwdriver 0.4 x 2.5 mm resp. 0.5 x 3.0 mm (recommended for wire gauges > 1.5 mm²)

Axial screw terminal

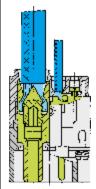

This termination combines the benefits of screw and crimp terminations:

- Less space required
- Easy handling
- No special tools

Remarks on the axial screw technique

The wire gauges mentioned in the catalogue refer to geometric wire gauges of cables.

Background:

According to DIN EN 60 228 for cables and insulated wires the wire gauge will be determined by conductance (Ω /km) and maximum wire diameter. A minimum cable diameter is not specified! (Example: nominal wire gauge = 95 mm² \rightarrow real, geometric wire gauge = 89 mm²)

Recommendation:

If you want to apply the axial screw technique in combination with cables that have cross sections extremely deviating from the nominal value, this must be checked seperately.

Strain relief:

In order to ensure that the contact is protected against radial stress, you must fix the cable at an adequate distance from the terminal.

Details for professional strain relief design can be found in the standard DIN VDE 0100-520: 2003-06 (see enclosed table).

Outer cable diameter (mm)	Maximum fixing distance (mm)		
	horizontal vertical		
D ≤ 9	250	400	
9 < D < 15	300	400	
15 < D < 20	350	450	
20 < D < 40	400	550	

Cables:

The axial screw technology is developed for wires according to DIN EN 60 228 class 5 (see table: Wire assembly according to DIN EN 60 228). Deviating cable assemblies have to be tested separately.

Assembly remarks:

Before starting the assembly the user must ensure that the axial cone is screwed fully downward to completely open the contact chamber.

After stripping the cable insulation the strands must not be twisted and the maximum cable insulation must not exceed the recommended dimension.

Insert the wire completely into the contact chamber until the copper strands reach the bottom. Keep the cable in position while applying the recommended tightening torque.

Maintenance of the axial screw termination:

In order to avoid damage to individual cable strands you must re-apply the tightening torque only once after the initial assembly of the application.

Wire gauge (mm²)	Stranded wires DIN EN 60228 class 2	Fine stranded wires DIN EN 60228 class 5	Super fine stranded wires DIN EN 60228 class 6			
0.5	7 x 0.30	16 x 0.20	28 x 0.15	64 x 0.10	131 x 0.07	256 x 0.05
0.75	7 x 0.37	24 x 0.20	42 x 0.15	96 x 0.10	195 x 0.07	384 x 0.05
1	7 x 0.43	32 x 0.20	56 x 0.15	128 x 0.10	260 x 0.07	512 x 0.05
1.5	7 x 0.52	30 x 0.25	84 x 0.15	192 x 0.10	392 x 0.07	768 x 0.05
2.5	7 x 0.67	50 x 0.25	140 x 0.15	320 x 0.10	651 x 0.07	1280 x 0.05
4	7 x 0.85	56 x 0.30	224 x 0.15	512 x 0.10	1040 x 0.07	
6	7 x 1.05	84 x 0.30	192 x 0.20	192 x 0.20 768 x 0.10 156		
10	7 x 1.35	80 x 0.40	320 x 0.20	1280 x 0.10	2600 x 0.07	
16	7 x 1.70	128 x 0.40	512 x 0.20	2048 x 0.10		
25	7 x 2.13	200 x 0.40	800 x 0.20	3200 x 0.10		
35	7 x 2.52	280 x 0.40	1120 x 0.20			
50	19 x 1.83	400 x 0.40	705 x 0.30			
70	19 x 2.17	356 x 0.50	990 x 0.30			
95	19 x 2.52	485 x 0.50	1340 x 0.30			
120	37 x 2.03	614 x 0.50	1690 x 0.30			
150	37 x 2.27	765 x 0.50	2123 x 0.30			
185	37 x 2.52	944 x 0.50	1470 x 0.40			
240	61 x 2.24	1225 x 0.50	1905 x 0.40			

Wire assembly according to DIN EN 60 228

Info 00 13

Insert	Wire gauge	Stripping I	ength	Tighter torqu	le	Max. cable insulation diameter	Size hexagon recess	Insert dimension for cable indication (ISP
	(mm²)	(mm)		(Nm)		(mm)	(SW)	(mm)
∃an® K 4/4 finger safe	6 16	6 mm²: 10 mm²: 16 mm²:	11+1 11+1 11+1	6 mm²: 10 mm²: 16 mm²:	2 3 4	8.9	2.5	7.4 PE: 8.9
	10 22	10 mm²: 16 mm²: 22 mm²:	11+1 11+1 11+1	10 mm²: 16 mm²: 22 mm²:	3 4 4	8.9 8.9 11	2.5	7.4 7.4 5.4 PE: 8.9
Han® K 4/4	6 16	6 mm²: 10 mm²: 16 mm²:	11+1 11+1 11+1	6 mm²: 10 mm²: 16 mm²:	2 3 4	8.9	2.5	7.4 PE: 8.9
	10 22	10 mm²: 16 mm²: 22 mm²:	11+1 11+1 13+1	10 mm²: 16 mm²: 22 mm²:	3 4 4	8.9 8.9 11	2.5	7.4 7.4 5.4 PE: 8.9
Han [®] K 6/12	2.5 8	2.5 mm ² : 4 mm ² : 6 mm ² : 8 mm ² :	5+1 5+1 8+1 8+1	2.5 mm ² : 4 mm ² : 6 mm ² : 8 mm ² :	1.5 1.5 2 2	6.2	2	7.4
	6 10	6 mm²: 8 mm²: 10 mm²:	8+1 8+1 8+1	6 mm ² : 8 mm ² : 10 mm ² :	2 2 2	6.2	2	4.7
Han [®] K 6/6	10 25	10 mm²: 16 mm²: 25 mm²:	13+/-1 13+/-1 13+/-1	10 mm²: 16 mm²: 25 mm²:	6 6 7	11.4	4	4.9
	16 35	16 mm²: 25 mm²: 35 mm²:	13+/-1 13+/-1 13+/-1	16 mm²: 25 mm²: 35 mm²:	6 7 8	11.4	4	4.9
Han® K 8/0	10 25	10 mm²: 16 mm²: 25 mm²:	13+/-1 13+/-1 13+/-1	10 mm²: 16 mm²: 25 mm²:	6 6 7	11.4	4	4.75
Han [®] Q 2/0 Han [®] Q 2/0 High Voltage	2.5 10	2.5 mm ² : 4 mm ² : 6 mm ² : 10 mm ² :	8+1 8+1 8+1 8+1	2.5 mm ² : 4 mm ² : 6 mm ² : 10 mm ² :	1.8 1.8 1.8 1.8	7.3	2	5.6
Han [®] Q 4/2 Han [®] Q 4/2 with Han-Quick Lock [®]	4 10	4 mm²: 6 mm²: 10 mm²:	8+1 8+1 8+1	4 mm ² : 6 mm ² : 10 mm ² :	1.8 1.8 1.8	7.3	2	5.6
Han [®] 200 A module without PE Han [®] 200 A module with PE	25 40	25 mm²: 40 mm²:	16 16	25 mm ² : 40 mm ² :	8 8	12 16	5	0
Llar® 100 A module	4070	40 mm ² : 70 mm ² :	16 16	40 mm ² : 70 mm ² :	9 10	12 16	5	0
Han [®] 100 A module	6 10	6 mm²: 8 mm²: 10 mm²:	13+/-1 13+/-1 13+/-1	6 mm ² : 8 mm ² : 10 mm ² :	4 4 4	11.4	2.5	4.9
	10 25	10 mm²: 16 mm²: 25 mm²:	13+/-1 13+/-1 13+/-1	10 mm²: 16 mm²: 25 mm²:	6 6 7	11.4	4	4.9
	16 35	16 mm²: 25 mm²: 35 mm²:	13+/-1 13+/-1 13+/-1	16 mm²: 25 mm²: 35 mm²:	6 7 8	11.4	4	4.9
	38	38 mm²:	13+/-1	38 mm²:	8	11.4	4	4.9
Han [®] 70 A module	6 16	6 mm²: 10 mm²: 16 mm²:	11+1 11+1 11+1	6 mm²: 10 mm²: 16 mm²:	m²: 3	2.5	7.4	
	14 22	14 mm²: 16 mm²: 22 mm²:	12.5+1 12.5+1 12.5+1	14 mm ² : 16 mm ² : 22 mm ² :	4 4 4	10	2.5	5.9
Han [®] 40 A module	2.5 8	2.5 mm ² : 4 mm ² : 6 mm ² : 8 mm ² :	5+1 5+1 8+1 11+1	2.5 mm ² : 4 mm ² : 6 mm ² : 10 mm ² :	1.5 1.5 2 2	4 4 6 10.5	2	4.7
	6 10	6 mm ² : 10 mm ² :	8+1 11+1	6 mm ² : 10 mm ² :	2 2	6 10.5	2	4.7

Info


Insert	Wire gauge	Stripping I	ength	Tightening torque (Nm)		Max. cable insulation diameter	Size hexagon recess	Insert dimensior for cable indication (ISK)
	(mm²)	(mm)			(mm)	(SW)	(mm)
Han [®] C module with axial screw	2.5 8	2.5 mm ² :	5+1	2.5 mm ² :	1.5	4	2	5.2
erminal		4 mm²:	5+1	4 mm²:	1.5	4		
		6 mm²:	8+1	6 mm²:	2	6		
		8 mm²:	8+1	8 mm²:	2	8.2		
	6 10	6 mm²:	8+1	6 mm²:	2	6	2	5.2
		10 mm²:	11+1	10 mm²:	2	8.2		
⊣an® K3/0 straight	25 40	25 mm²:	22	25 mm²:	8	15	5	8.2
-		40 mm²:	22	40 mm²:	8			
	35 70	35 mm²:	22	35 mm²:	8	15	5	8.2
		50 mm²:	22	50 mm²:	9			
		70 mm²:	22	70 mm²:	10			
Han [®] K3/0 angled	25 40	25 mm²:	22	25 mm²:	8	15	5	9
3 1		40 mm ² :	22	40 mm ² :	8	-		-
	35 70	35 mm²:	22	35 mm²:	8	15	5	9
		50 mm ² :	22	50 mm²:	9		Ū	, i i i i i i i i i i i i i i i i i i i
		70 mm²:	22	70 mm²:	10			
Han [®] K3/2 straight	35 70	35 mm²:	22	35 mm²:	8	power: 15	5	power: 8.2
	PE: 25 40	50 mm ² :	22	50 mm ² :	9	ponon ro	Ũ	ponon o.2
		70 mm²:	22	70 mm²:	10			
		PE:	14			PE: 10		PE: 7.2
Han® K3/2 angled	2540	25 mm²:	22	25 mm²:	8	power: 15	5	power: 9.0
3 1		40 mm ² :	22	40 mm ² :	8			
		PE:	14			PE: 10		PE: 7.2
	35 70	35 mm²:	22	35 mm²:	8	power: 15	5	power: 9.0
	PE: 25 40	50 mm²:	22	50 mm²:	9	PE: 10		PE: 7.2
		70 mm²:	22	70 mm²:	10			
Han® HC Modular 350	20 35	20 mm²:	19+1	20 mm²:	8	19.5	5	13
		35 mm²:	19+1	35 mm²:	8			
	35 70	35 mm²:	19+1	35 mm²:	8	19.5	5	13
		50 mm²:	19+1	50 mm²:	10			-
		70 mm²:	19+1	70 mm²:	12			
	95 120	95 mm²:	19+1	95 mm²:	14	19.5	5	13
		120 mm ² :	19+1	120 mm ² :	16		Ū	
Ground contact for	35 70	35 mm²:	19+1	35 mm²:	8	_	5	_
Han [®] HC Modular	00	50 mm ² :	19+1	50 mm ² :	10		Ũ	
		70 mm²:	19+1	70 mm²:	12			
Han [®] HC Modular 650	60 70	60 mm ² :	23+2	60 mm ² :	12	27	8	28
		70 mm ² :	23+2	70 mm²:	12		č	20
	70 120	70 mm²:	23+2	70 mm²:	12	26.5	8	28
	10120	95 mm ² :	23+2	95 mm ² :	14	20.0	0	20
		120 mm ² :	23+2	120 mm ² :	14			
	150 185	150 mm ² :	23+2	150 mm ² :	17	26.5	8	28
	100 100	185 mm ² :	23+2 23+2	185 mm ² :	18	20.0	0	20

Overview inserts with axial screw terminal

Insulating base dimension for the cable marking (ISK)


Marking the proper cable position for the axial screw connection contact point:

By markering the cable sheathing you can specify the proper point for tightening the axial screw on the connecting cable. If the cable is pushed into the insulating base up to the marker (where the marker is flush with the upper edge of the insulating base), then the cable is in the correct position for being connected. The following figure (on the next page) illustrates this process when using the Han[®] HC Modular 350 contact. The marker and the upper edge of the insulating base are at the same level (as indicated by the dashed line).

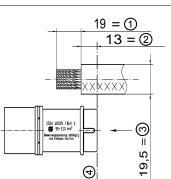


- ① stripping length
- ② insulator dimension (ISK dimension)
- ③ max. cable insulation diameter
- ④ sink line

Cage-clamp terminal

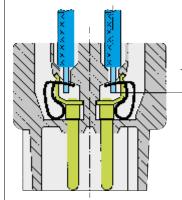

- This termination method requires very little preparation of the wire and no special tools, leading to a low installed cost and a high degree of mechanical security.
- For all stranded and solid wires with a cross section 0.14 to 2.5 mm².
- Ease of termination. Conductor and screwdriver are in same plane.
- No special preparation of stripped conductor.
- The larger the conductor the higher the clamping force.
- The termination is vibration-proof.
- Guaranteed constant low resistance connection of the cageclamp terminal.
- The cage-clamp system is internationally approved.
 VDE, CSA, UL, ÖVE, SEMKO, LCIE (France), Germanischer Lloyd, DET Norske Veritas

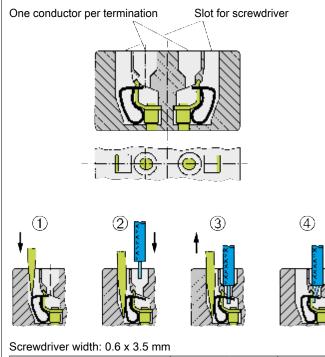

Kontakteinsätze	max. Lo querso	Abisolier- länge		
	(mm²)	AWG	l (mm)	
Han [®] ES, Han [®] Hv ES	0.14 2.5	26 14	7 9	
Han [®] ESS	0.14 2.5	26 14	9 11	
Han [®] ES Press	0.14 2.5	26 14	9 11	
Han [®] K 4/4	0.14 2.5	26 14	7 9	
Han [®] ES Modul	0.14 2.5	26 14	7 9	

Han[®] ES Press


The circular openings in the insert are used to hold the wire that is being connected. Note that there are two rows of rectangular holes (intended for plug-in jumpers) located between the contact openings of the Han[®] ES Press insert.

Note: Only one wire per termination point!


Each termination point is, in principle, only suited to hold a single wire. When required, two or more wires may be contacted per termination point; contact HARTING Technical Support first for more information.

Note!

An effective and durable spring clamp connection requires that the wire is properly stripped. The correct stripping lengths for the Han[®] ES Press contacts are specified in the table below, left side.

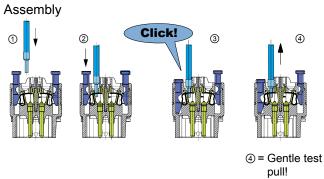



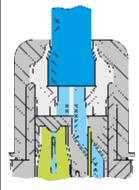

Inserts	max. wire gauge						
	(mm²)	AWG					
M8-S/M12-S	0.14 0.34	26 22					
Circular connectors M12 angled	0.25 0.50	24 (7/32) 22					
Circular connectors M12-L	0.34 0.75	22 18					
M12-L PROFIBUS	0.25 0.34	24 22					
M12-L Ethernet	0.25 0.34	24 22					
	0.34 0.5	22 18					
Panel feed through Pg 13.5 /M20	0.75 1.50	18 16					
Panel feed through Pg 9	0.25 0.50	24 (7/32) 22					
HARAX [®] 3 A	0.75 1.5	18 16					


General				Extract from DIN VDE 0110-1 and IEC 60 664-1, Para. 2.2.2.1.1								
ors such as fu	connectors entails nctionality, the num is equally importa	ber of contacts, cu	irrent and volt-	Equipment of overvoltage category IV is for use at the origin of the installation.								
onnectors are his in turn me hey are to be	e to be used and th eans that, dependent installed and purs	Note 1: Examples of such equipment are electricity meters an primary overcurrent protection equipment. Equipment of overvoltage category III is equipment in fixed in stallations and for cases where the reliability and the availability										
lifferent voltag lectors.	e and current ratin											
The most important influencing factors and the corresponding electrical characteristics of the associated connectors are illus- rated here in greater detail.				of the equipment is subject to special requirements. <u>Note 2:</u> Examples of such equipment are switches in the fixe installation and equipment for industrial use with permanent cornection to the fixed installation.								
Overvoltage	ervoltage category				Equipment of overvoltage category II is energy-consuming equipment to be supplied from the fixed installation.							
he location at	ge category is depe which the equipm	ent is installed. It	describes the	Note 3: Examples of such equipment are appliances, portable tools and other household equipment with similar loads. If such equipment is subjected to special requirements with re gard to reliability and availability, overvoltage category III applies								
naximum ove ower supply s	rvoltage resistance system fault, e. g. ir	e of a device in t in the event of a lig	he event of a htening strike.									
n that it determ	e category affects t nines the clearance re are 4 overvoltag		Equipment of overvoltage category I is equipment for connectio to circuits in which measures are taken to limit transient overvol ages to an appropriately low level.									
	uipment for industrial use, such as fall HARTING heavy duty n connector, fall into Overvoltage Category III.				<u>Note:</u> Examples are protected electronic circuits.							
•	lse voltages (Ta		,									
Voltage line- to-neutral derived from	(=	inal voltages pres Rated insulation v	oltage of equipme	ent)								
nominal volta- ges A.C. or D.C. up to and	4-wire systems 3-wire systems 2-wire system		Single-phase 2-wire systems A.C. or D.C.	Single-phase 3-wire systems A.C. or D.C.	Overvoltage category							
including					I			IV				
			r 1	r 1	Special protected levels	Level for electrical equipment (household and others)	Level for distribution supply systems	Input leve				
	ŦŦŦ	₹J ₹J ₹J						V				
V			V	V	V	V	V	V V				
V 50		한 번 빈 	V 12.5 24 25 30 42 48	V 30 60	V 330	V 500	V 800	1500				
50 100	66/115	66	12.5 24 25 30 42 48 60	30 60	330 500	500 800	800 1500	1500 2500				
50 100 150	66/115 120/208* 127/220	66 115, 120 127	12.5 24 25 30 42 48 60 100** 110, 220	30 60 100 200** 110 220 120 240	330 500 800	500 800 1500	800 1500 2500	1500 2500 4000				
50 100 150 300	66/115 120/208* 127/220 220/380, 230/400 240/415, 260/440 277/480	66 115, 120 127 200**, 220 230, 240 260, 277	12.5 24 25 30 42 48 60 100** 110, 220 220	30 60 100 200** 110 220 120 240 220 440	330 500 800 1500	500 800 1500 2500	800 1500 2500 4000	1500 2500 4000 6000				
50 100 150	66/115 120/208* 127/220 220/380, 230/400 240/415, 260/440	66 115, 120 127 200**, 220 230, 240 260, 277 347, 380, 400	12.5 24 25 30 42 48 60 100** 110, 220	30 60 100 200** 110 220 120 240	330 500 800	500 800 1500	800 1500 2500	1500 2500 4000				

Infc 00 18

Electrical engineering data

Pollution degree	The conditions fulfills,	
The dimensioning of operating equipment is dependent on envi-		
ronmental conditions. Any pollution or contamination may give rise to conductivity that, in combination with moisture, may affect the insulating properties of the surface on which it is deposited. The	 a connector which is protected to at least IP 54 as per IEC 60 529, a connector which is installed in a housing and which as described in the standard is disconnected for testing and maintenance pur- 	Info
pollution degree influences the design of components in terms of the creepage distance.	poses only,	
The pollution degree is defined for exposed, unprotected insula- tion on the basis of environmental conditions.	• a connector which is installed in a housing and which when disconnected is protected by a cap or cover to at least IP 54,	
	• a connector located inside a switching cabinet to at least IP 54.	
HARTING heavy duty Han connectors are designed as standard for Pollution Degree 3.	These conditions do not extend to connectors which when dis- connected remain exposed to the industrial atmosphere for an indefinite period.	
Pollution degree 1 in air-conditioned or clean, dry rooms, such as computer and measuring instrument rooms, for example.	It should be noted that pollution can affect a connector from the inside of an installation outwards.	
Pollution degree 2 in residential, sales and other business premises, precision en- gineering workshops, laboratories, testing bays, rooms used for medical purposes. As a result of occasional moisture condensa- tion, it is to be anticipated that pollution/contamination may be temporarily conductive.	Typical applications in which to choose pollution degree 2 connectors:	
Pollution degree 3 in industrial, commercial and agricultural premises, unheated stor- age premises, workshops or boiler rooms, also for the electrical	• A connector serving a drive motor which is disconnected only for the purpose of replacing a defective motor, even when the plant or system otherwise calls for pollution degree 3.	
components of assembly or mounting equipment and machine tools.	Connectors serving a machine of modular design which are dis- connected for transport purposes only and enable rapid erection	
Pollution degree 4 in outdoor or exterior areas such as equipment mounted on the roofs of locomotives or tramcars.	and reliable commissioning. In transit, protective covers or ad- equate packing must be provided to ensure that the connectors are not affected by pollution/contamination.	
Extract from DIN EN 60664-1 (VDE 0110-1), Para. 4.6.2	 Connectors located inside a switching cabinet to IP 54. In such cases, it is even possible to dispense with the IP 54 housings of the connectors themselves. 	
Pollution degree 1: No pollution or only dry, non-conductive pollution occurs. The pollution has no influence.	Specifying electrical data	
Pollution degree 2: Only non-conductive pollution occurs except that occasionally a temporary conductivity caused by condensation is to be excepted.	Electrical data for connectors are specified as per DIN EN 61 984.	
Pollution degree 3: Conductive pollution occurs or dry non-con- ductive pollution occurs which becomes conductive due to con- densation which is to be expected.	This example identifies a connector suitable for use in an unearthed	
Pollution degree 4: Continuous conductivity occurs due to con- ductive dust, rain or other wet conditions.	power system or earthed delta circuit (see page 00.22, Table B2 of DIN EN 60 664-1):	
Special ruling for connectors	16 A 500 V 6 kV 3	
Subject to compliance with certain preconditions, the standard for connectors permits a lower pollution degree than that which applies to the installation as a whole. This means that in a pollution degree 3 environment, connectors may be used which are electrically rated for pollution degree 2. The basis for this is contained in DIN EN 61984, Para. 6.19.2.3.	Working current Working voltage Rated impulse voltage Pollution degree	
Extract form DIN EN 61 984, Para. 6.19.2.3	This example identifies a connector suitable exclusively for use in earthed power systems (see page 00.22, Table B2 of DIN EN 60 664-1):	
For a connector with a degree of protection IP 54 or higher according to IEC 60 529 the insulating parts inside the enclosure may be dimensioned for a lower pollution degree.	10 A 230/400 V 4 kV 3	Info
This also applies to mated connectors where enclosure is ensured by the connector housing and which may only be disengaged for test and maintenance purposes.	Working voltage conductor – ground Working voltage conductor – conductor Rated impulse voltage Pollution degree	00

Electrical engineering data

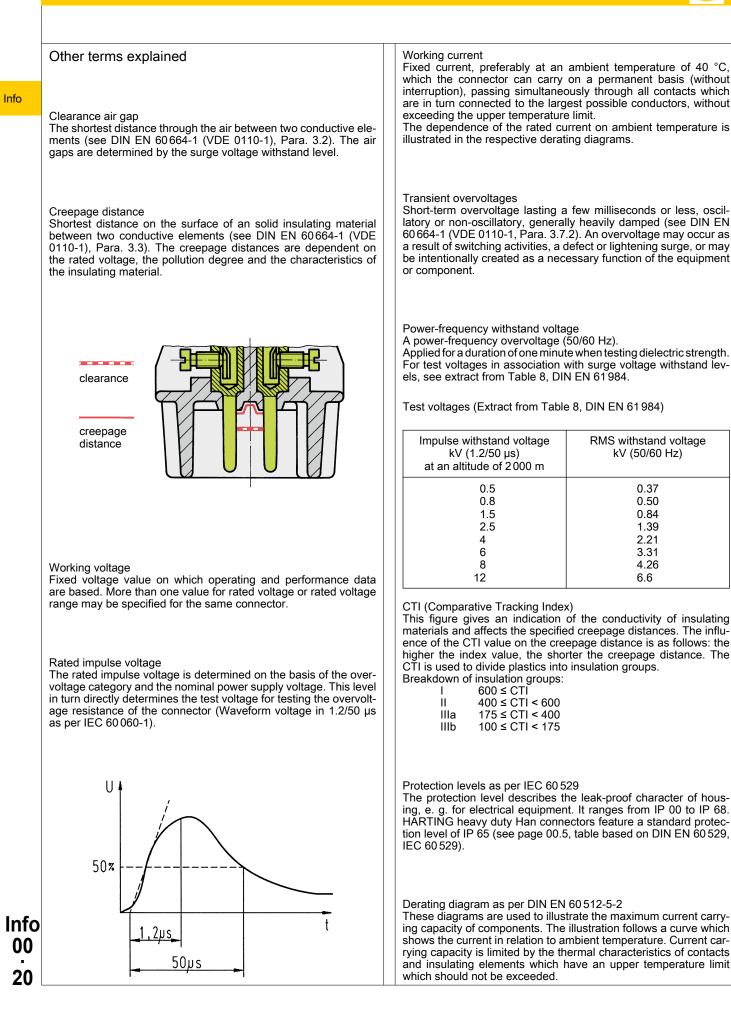

Current carrying capacity

Current carrying capacity

The current carrying capacity is determined in tests which are conducted on the basis of the DIN EN 60512-5-2. The current carrying capacity is limited by the thermal properties of materials which are used for inserts as well as by the insulating materials. These components have a limiting temperature which should not be exceeded.


The relationship between the current, the temperature rise (loss at the contact resistance) and the ambient temperature of the connector is represented by a curve. On a linear coordinate system the current lies on the vertical line (ordinate) and the ambient temperature on the horizontal line (abscissa) which ends at the upper limiting temperature.

In another measurement the self-heating (Δt) at different currents is determined.

At least 3 points are determined which are connected to a parabolic curve, the basic curve.


The corrected current carrying capacity curve is derived from this basic curve. The reasons for the correction are external factors that bring an additional limitation to the current carrying capacity, i.e. connectable wire gauge or an unequal dispersion of current.

The derating diagrams pictured as curve have been primarily determined with tin-plated cables as well as with physical cross sections close to the respective ISO-cable cross section.

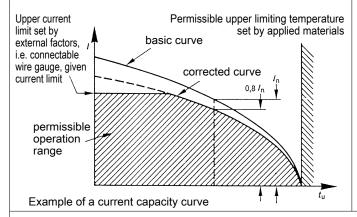

Current carrying capacity of copper wires

Definition: The rated current is the continuous, not interrupted current a connector can take when simultaneous power on all contacts is given, without exceeding the maximum temperature.

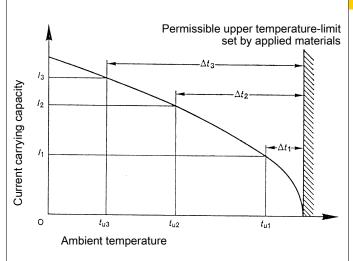



Acc. to DIN EN 61984 the sum of ambient temperature and the temperature rise of a connector shall not exceed the upper limiting temperature. The limiting temperature is valid for a complete connector, that means insert plus housing.

As a result the insert gives the limit for the temperature of a complete connector and thus housings as well.

In practice it is not usual to load all terminals simultaneously with the maximum current. In such a case single contacts can be loaded with a higher current as permitted by the current capacity curve, if less than 20 % of the whole is loaded.

However, for these cases there are no universal rules. The limits have to be determined individually from case to case. It is recommended to proceed in accordance with the relevant rules of the DIN EN 60 512-5-2.

	Diameter [mm ²] of single wires in a three-phase system	0.75	1	1.5	2.5	4	6	10	16	25	35
	Type of installation										
B1	Conductors/single core cables in conduit and cable trunking systems	8.6	10.3	13.5	18.3	24	31	44	59	77	96
B2	Cables in conduit and cable trunking systems	8.5	10.1	13.1	17.4	23	30	40	54	70	86
C	Cables on walls	9.8	11.7	15.2	21	28	36	50	66	84	104
	<u>~~~~~~</u>										
E	Cables on open cable trays	10.4	12.4	16.1	22	30	37	52	70	88	110
	Depiction in accordance with DIN EN 60 204-1 for PVC-insulated copper wires in an am	bient ten	peratur	e of + 4) °C und	ler perm	anent o	perating	conditi	ons.	
	For different conditions and temperatures, installations, insulation materials or conductors the relevant corrections have to be carried out.										
				_			_		_		


nfo

Current carrying capacity

Short-time current carrying capacity

Info


A short-time overload in circuits can be generated by switching operations such as the starting of a motor or a short circuit in a faulty installation. This can cause thermal stress at the contact. These short and very high increases cannot be dissipated quickly and therefore a local heating effect at the contact is the result. Contact design is an important feature when transient currents are encountered. HARTING contacts are machined from solid material and are therefore relatively unaffected by short overloads when compared to stamped and formed designs. For guidance please see the table below.

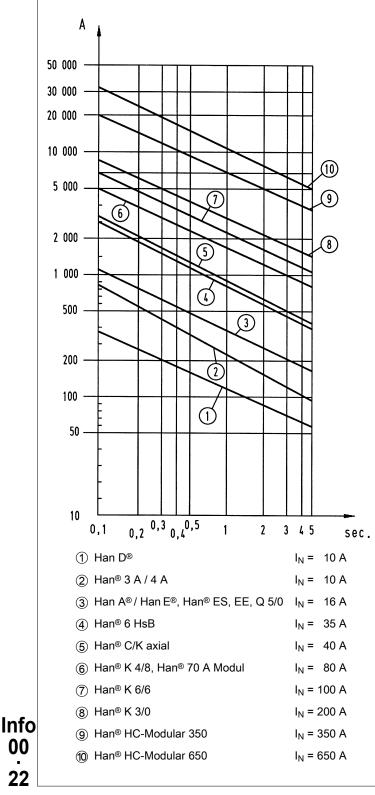

Low currents and voltages

HARTING's standard contacts have a silver plated surface. This precious metal has excellent conductive properties. In the course of a contact's lifetime, the silver surface generates a black oxide layer due to its affinity to sulphur. This layer is smooth and very thin and is partly interrupted when the contacts are mated and unmated, thus guaranteeing very low contact resistances. In the case of very low currents or voltages small changes to the transmitted signal may be encountered. This is illustrated below where an artifically aged contact representing a twenty year life is compared with a new contact.

In systems where such a change to the transmitted signal could lead to faulty functions and also in extremely aggressive environments, HARTING recommend the use of gold plated contacts.

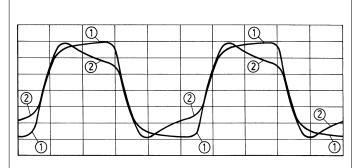


Changes to the transmitted signal after artifical ageing

(1) new contact

(2) after ageing

Below is a table derived from actual experiences.

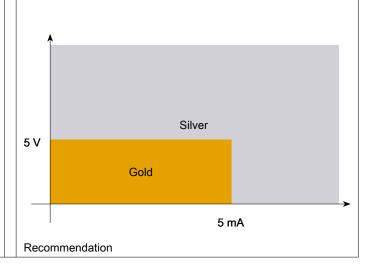

00 22


Metric cable thread

The metric thread is specified in the international DIN EN 50262 standard. The standard describes the metric series M 12 to M 63.

The thread dimension in mm is given by the product type description. E.g. M 20 refers to 20 mm thread diameter.

For easy identification, metric threaded hoods and housings are marked with an


Cable range of metric glands:

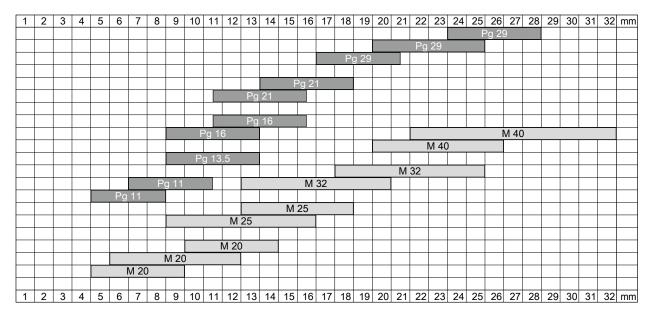

Cable

The diagram shows different cable-diameters, being dependent on wire gauges and number of conductors.

All data are averages for commercial cables.

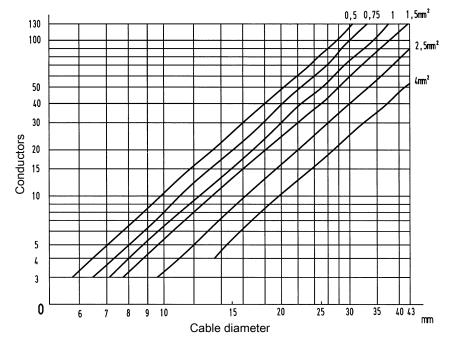

Declaration of Conformity



Info



Supplier's Declaration of Conformity (in accordance with ISO/IEC 17050-1) Konformitätserklärung eines Anbieters (nach ISO/IEC 17050-1)

Issuer's name: Name des Ausstellers

HARTING Electric GmbH & Co. KG

Issuer's address: Anschrift des Ausstellers Wilhelm-Harting-Str. 1 32339 Espelkamp Germany

Product(s): Produkt(e): Han A® Han® B Han-Brid® Han-Com® Han D® Han D® Han D® Han D® Han D® Han Co®

Han E® Han E® AV Han® EE Han® EEE Han® ES Han® ESS Han® HC Modular 350 Han® HPR Han® HsB Han® K 3/0 Han® K 3/2 Han® M Han-Modular® Han-Power® Han® Q Han-Yellock® Han Staf®

The product(s) as described above are in conformity with the requirements of: Die oben beschriebenen Produkte sind konform mit den folgenden Anforderungen:

IEC 61984 (2008-10)

Connectors - Safety requirements and tests Steckverbinder - Sicherheitsanforderungen und Prüfungen

Espelkamp, 2016-05-18

Uwe Gräff

Managing Director

Espelkamp, 2016-05-18

Andre Beneke Director Product & Industry Segment Management

The given information reflects our current knowledge. It is based on statements and information of our suppliers and third parties. This declaration does not include guarantees of quality or durability. Topicality, completeness and accuracy of the content are subject to change without notice. The safety instructions are to be respected. The user is self-responsible for the evaluation of the information and the concrete measures derived from it. Besides that, HARTING is liable only for culpable, intentional or grossly negligent acting as long as no mandatory legal liability for damages of life, body, health or Product Liability Act exists.

Die vorstehenden Informationen spiegeln unseren derzeitigen Kenntnisstand, dem insbesondere die Aussagen und Informationen unserer Lieferanten und Dritter zugrunde liegen, wider, beinhalten jedoch keine Beschaffenheits- oder Haltbarkeitsgarantien. Im Hinblick auf Aktualität, Vollständigkeit und Richtigkeit der Inhalte behalten wir uns Änderungen jederzeit vor. Die Sicherheitshinweise sind zu beachten, wobei der Amwender für die Bewertung der Informationen und die hieraus abgeleitete konkrete Verwendung selbst verantwortlich ist. Im Übrigen haftet HARTING nur für schuldhaftes vorsätzliches oder grob fahrtässiges Handeln, soweit nicht eine zwingende gesetzliche Haltung für Schäden an Leben, Körper oder Gesundheit oder nach dem Produkthaftungsgesetz besteht.

SDoC Han Connectors general IEC 61984.00.pdf

1/1

NOR 0893/01

Info 00 24